

**PERCOLATION TEST
BY**

**Ron Duncan, REHS #3336
4400 Duncan Hill Rd. Rescue, Calif. 95672
530-677-3708, cell (916) 712-8015
(fax) 530-676-3758, perctest@starband.net
Yahoo.com**

Location of Property:

2001 Lone Barn ct Somerset

Owner/Builder AJS [REDACTED]
Address _____

APN 046-061-54 40ac
Phone _____

Test Date: 4/19/14

Location of Test Holes

Soil Profile

Soil Mantle 0-5' dk brown sandy clay loam 5'-9 1/2' lt brown granular clay loam
Hole #1 48"
Hole #2 40"
Hole #3 34"
Hole #4 31"

No signs of groundwater

Text

Time	Hole #1	Hole #2	Hole #3	Hole #4
0	0	0	0	0
30	-2.0-0	-1.8-0	-2.8-0	-1.9-0
60	-1.8-0	-1.7-0	-2.5-0	-1.7-0
90	-1.7-0	-1.5-0	-2.1-0	-1.5-0
120	-1.7-0	-1.5-0	-2.0-0	-1.5-0
150	-1.6-0	-1.5-0	-1.8-0	-1.4-0
180	-1.6	-1.4	-1.8	-1.4
	18.75 mpi	21.4 mpi	16.6 mpi	21.4 mpi

Average Percolation rate 19.6 mpi

Test Performed by: Ron Duncan REHS #3336

PERCOLATION TEST
BY
Ron Duncan, REHS #3336
4400 Duncan Hill Rd.
Rescue, Calif. 95672
530-677-3708, cell (916) 712-8015
(fax) 530-676-3758, perctest@yahoo.com

THIS IS A BILL

Location of Property:

7001 Lone Barn Ct

Owner/Builder

A. J. [REDACTED]

APN

046-061-54

Address

Phone

[REDACTED]

Please remit for the following:

Percolation Test
Septic System Design
Inspection (s) + Eval.
Backhoe Services
Other: Co. fee
Total:

600

350

213


\$1163

← To be Done later

Send Remittance to:

Ron Duncan, RS
P.O. Box 314
Rescue, California 95672

Services have been performed and payments are due upon receipt of this bill,
Thank You

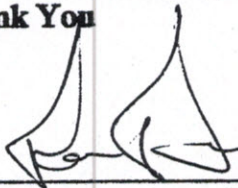

REHS #3336

Ronald D. Duncan, REHS #3336
Environmental Consultant